


Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-026	Smoke	8/13/2008	ADS/TM	S07WW_010MH	Dry	Yes	281.88

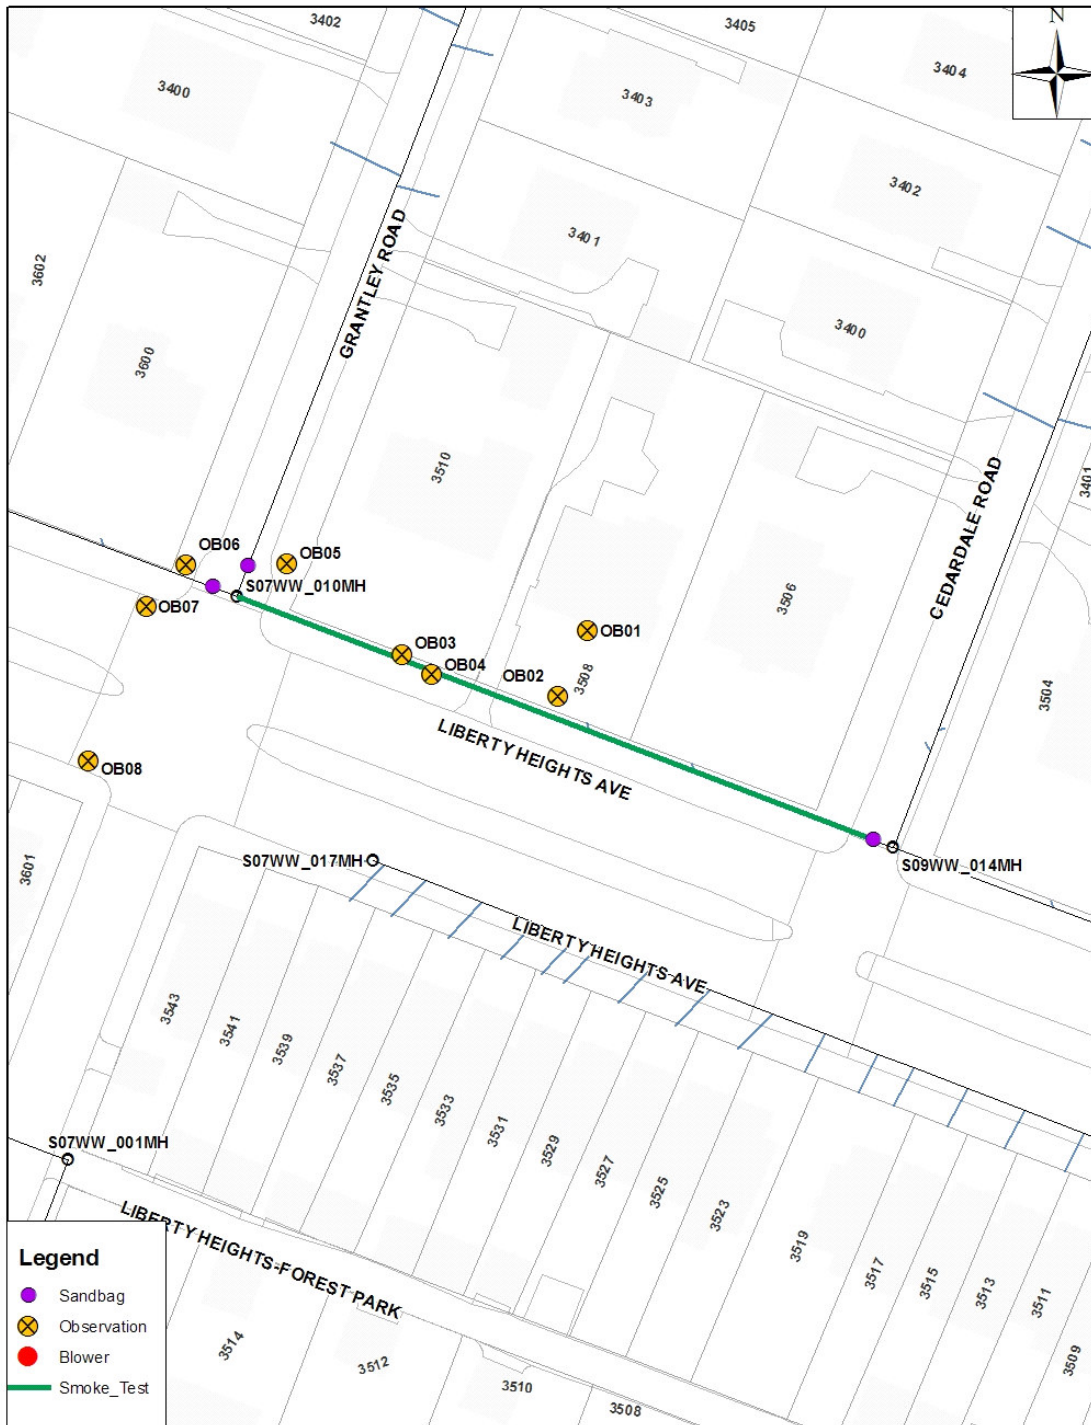

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-026	Smoke	8/13/2008	ADS/TM	S07WW_010MH	Dry	Yes	281.88

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (in)
S07WW_010G1	S07WW_010MH	S09WW_014MH	281.8835	8

Observations & Photos

Obs_ID S1028-026-OB01

Address 3508 Liberty Heights Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S09WW_014MH

Comments Smoke from cleanout in front yard. 3508 Liberty Heights Ave.



Picture \S1028-026-OB01-P01.jpg

Comments Front of house, 3508 Liberty Heights Ave.

Obs_ID S1028-026-OB02

Address 3508 Liberty Heights Ave

Status Private

Source Other

Location Yard - front

Nearest MH S09WW_014MH

Comments Smoke from ground near water meter. 1 ft. from public sidewalk. 3508 Liberty Heights Ave.



Picture \S1028-026-OB02-P01.jpg

Comments Smoke observed near public sidewalk at 3508 Liberty Heights Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-026	Smoke	8/13/2008	ADS/TM	S07WW_010MH	Dry	Yes	281.88

Obs_ID S1028-026-OB03

Address 3510 Liberty Heights Ave

Status Public

Source Main Sewer

Location Yard - front

Nearest MH S07WW_010MH

Comments Smoke 1 ft. from sidewalk along main sewer line. 3510 Liberty Heights Ave.



Picture \S1028-026-OB03-P01.jpg

Comments Smoke from main sewer crack. Front of house, 3510 Liberty Heights Ave.

Obs_ID S1028-026-OB04

Address 3510 Liberty Heights Ave.


Status Public

Source Main Sewer

Location Yard - front

Nearest MH S07WW_010MH

Comments Smoke near stairs of private walkway along main sewer. 3510 Liberty Heights Ave.

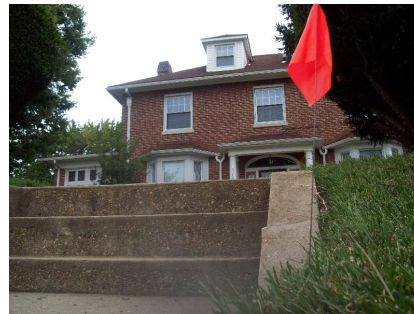

Picture \S1028-026-OB04-P01.jpg

Comments Smoke from main sewer crack. Front of house, 3510 Liberty Heights Ave.

Obs_ID S1028-026-OB05

Address Liberty Heights Ave & Grantley Rd

Status Public

Source Catch Basin

Location Curb

Nearest MH S07WW_010MH

Comments Smoke at catch basin on NE corner of Liberty Heights Ave & Grantley Rd.



Picture \S1028-026-OB05-P01.jpg

Comments Liberty Heights Ave & Grantley Rd facing northeast

Obs_ID S1028-026-OB06

Address Liberty Heights Ave & Grantley Rd

Status Public

Source Catch Basin

Location Curb

Nearest MH S07WW_010MH

Comments Smoke at catch basin on NW corner of Liberty Heights Ave & Grantley Rd.



Picture \S1028-026-OB06-P01.jpg

Comments Liberty Heights & Grantley Rd facing northwest

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-026	Smoke	8/13/2008	ADS/TM	S07WW_010MH	Dry	Yes	281.88

Obs_ID S1028-026-OB07

Address Liberty Heights Ave & Grantley Rd

Status Public

Source Catch Basin

Location Curb

Nearest MH S07WW_005MH

Comments Smoke at catch basin on NW corner of Liberty Heights Ave & Grantley Rd.



Picture \S1028-026-OB07-P01.jpg

Comments Liberty Heights Ave & Grantley Rd facing northwest

Obs_ID S1028-026-OB08

Address Liberty Heights Ave & Grantley Rd

Status Public

Source Catch Basin

Location Curb

Nearest MH S07WW_010MH

Comments Smoke at catch basin on SW corner of Liberty Heights Ave & Grantley Rd.



Picture \S1028-026-OB08-P01.jpg

Comments Liberty Heights Ave & Grantley Rd looking southwest